
Hard Polyurethane Tubing/Standard Type TUH Series





Bend the tube into U-form at a temperature of 20°C. Fix one end and close loop gradually. Measure 2R when the tube breaks or is crushed.

Max. Operating Pressure

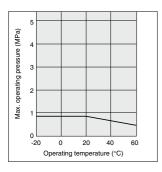

Precautions


Be sure to read this before handling the products. Refer to back page 50 for Safety Instructions and pages 13 to 17 for Fittings and Tubing Precautions.

∆Caution

- Please consult with SMC regarding other fluids. Because ester polyurethane is used, water cannot be used due to the occurrence of hydrolysis.
- Abnormal temperature rise caused by adiabatic compression may result in the tube bursting.
- The value of the minimum bending radius is measured at the temperature of 20°C as shown in the figure above.

Model/Specifications • - 20 m roll							
Model	TUH	10428	TUH0644	TUH0858	TUH1073	TUH1288	
O.D. (mm)		4	6	8	10	12	
I.D. (mm)	2	2.8	4.4	5.8	7.3	8.8	
Black (B)]—[_ <u>_</u>	_ _	- <u></u>	
White (W) Blue (BU)		₽ ₽	• •	 			
Translucent (N) – [• <u> </u>	— <u>ē</u> —	— <u> </u>	— <u> </u>	—— — —	
Fluid				Air			
Mar	20°C	0.8					
Max operating pressure (MPa)	40°C	0.65					
,	60°C			0.5			
Applicable fittings		One-touch fittings					
Applicable fitt	ings						
Applicable fitt Min. bending radio	•	10	18	24	30	36	
	us (mm)	10	18	24 20 to 60		36	


How to Order

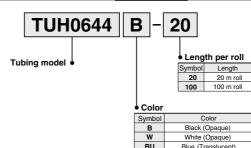

N	Translucent (Material color)


Hard Polyurethane Tubing/High Pressure Type TUH Series RoHS





Max. Operating Pressure

Fixed end

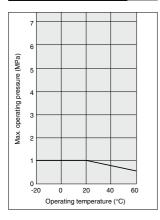


Precautions


Be sure to read this before handling the products. Refer to back page 50 for Safety Instructions and pages 13 to 17 for Fittings and Tubing Precautions.

Caution

- 1. Please consult with SMC regarding other fluids. Because ester polyurethane is used, water cannot be used due to the occurrence of hydrolysis.
- 2. Abnormal temperature rise caused by adiabatic compression may result in the tube bursting.
- 3. The value of the minimum bending radius is measured at the temperature of 20°C as shown in the figure above.

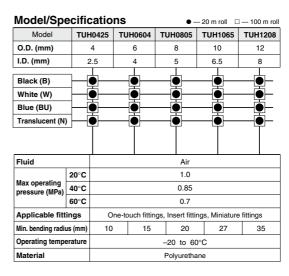

How to Order



• 00101	
Symbol	Color
В	Black (Opaque)
w	White (Opaque)
BU	Blue (Translucent)
N	Translucent (Material color)

Length

20 m roll

100 m roll

KQ2
KQB2
KS KX
ИM
KF
8/1
IVI H/DL L/LL
KC
KK
KK130
DM
KDM
VD
KR
KA
KQG2
KG
KFG2
MS
KKA
KP
LQ
MQR
T
IDK